

1. Remove cover panel under the left side of the instrument panel or the combination instrument cluster (Figure 1 and 2).
2. Disconnect 2-pole plug at speed sensor.
3. Connect ohmmeter to speed sensor. The ohmmeter reading should be 50 to 106 ohms for the 1st version or 650 to 1370 for the 2nd version.
4. If the readings are outside the specified values, the speed sensor must be replaced.

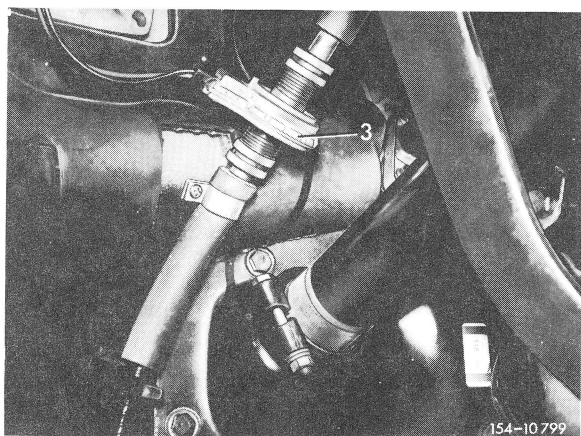


Fig. 1 Location of speed sensor in speedometer cable (1st version until April 1976).

3 speed sensor

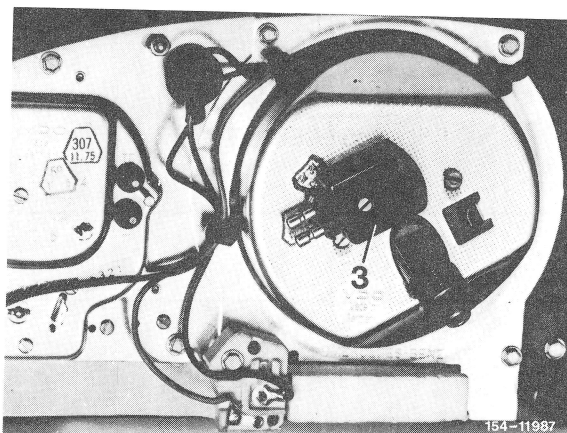


Fig. 2 Location of speed sensor on back of instrument cluster (2nd version as of April 1976)

3 speed sensor