

## Note

Since April 1972 a modified windshield header molding and modified guide bearings have been installed in these vehicles.

## Production Breakpoint

Type 107.043 as from Chassis End No. 006 914

Type 107.044 as from Chassis End No. 004 182

When installing the modified windshield header molding in vehicles with lower chassis end numbers, the two guide bearings and the two washers must also be replaced.

## Removal

- 1 Unscrew windshield header molding (1) from front panel frame.

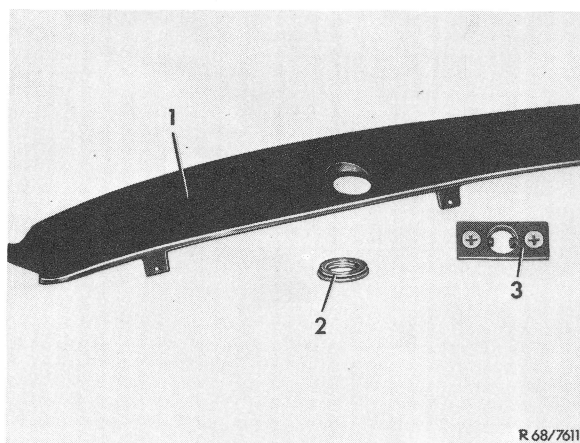


Fig. 1

- 1 Windshield header molding      3 Guide bearing  
2 Washer

- 2 Remove both guide bearings.

## Installation

- 3 Install modified guide bearings (3).
- 4 Insert washers (2) into the two bores of windshield header molding (1) (Fig. 1).

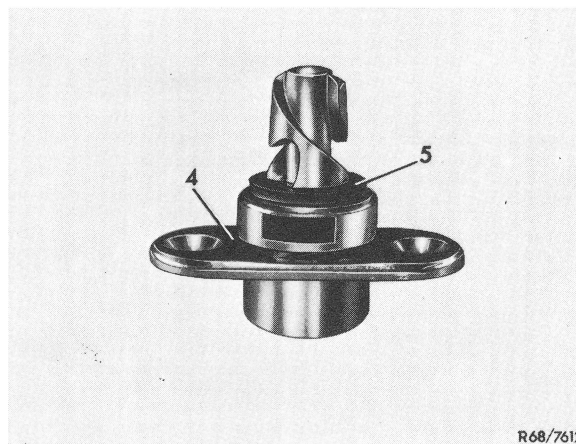


Fig. 2

- 4 Catch      5 Plastic washer

**Note:** The top catch can also be installed in types of model series 113. On these vehicles, however, each catch should be fitted with an additional plastic washer Part No. 111 776 80 97.