


Preparation for test

- 1 Remove glove box (68-140).
- 2 Remove small cover under instrument panel at the right.

Connecting adapter to volt/ohm measuring instrument

- 3 Pull 12-pole coupler from electronic switching unit (9) for temperature control and connect to adapter. Use yellow test card (issue October 1980).

9 Electronic control unit for temperature control

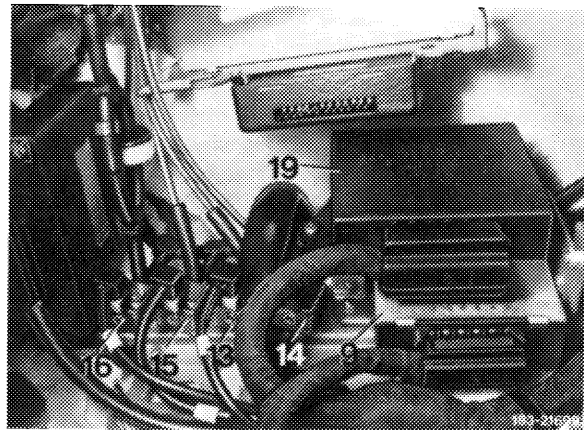

- 4 Connect adapter with volt/ohm measuring instrument to 12-pole coupler and switch adapter to test step 1.

